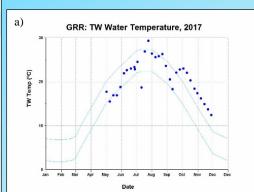
## 2GRR11003 2GRR21001 2GRR13001 @ 2GRR20002 2GRR12001 2GRR10005

Figure 1. GRR sample sites in 2017 for field and chemical data.

Water Quality (WQ) in the Tailwater is assessed by analyzing exceedances of WQ criteria established by the KY Division of Water (KDOW). No criteria were exceeded in the tailwater (2GRR10000; Figure 1). However, GRR exceeded the USEPA's recommended criteria for total nitrogen (Criteria: 0.69 mg/L; Measurements: 0.71 mg/L). All exceedances have been reported to KDOW.

Temperature and dissolved oxygen (DO) profile data are regularly collected from LRL lakes. This data informs water control engineers on how to best use existing selective withdrawal capabilities to meet downstream WQ targets established by each lake's Water Control Plan (WCP) and state criteria. Figure 2a shows a time series graph of the 2017 tailwater water temperature compared with the guide curve from the lake's WCP. Figure 2b shows a 2017 time series graph of the lake's tailwater dissolved oxygen data with the applicable state criteria (blue line).



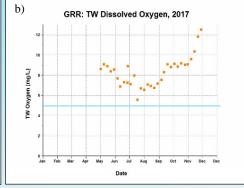


Figure 2. GRR time series data collected from the tailwater (2GRR 10000; Figure 1): a) water temperature; and b) dissolved oxygen.

## Green River Lake (2017)

Green River Lake (GRR) is located in Adair and Taylor counties in Kentucky (KY). The dam was built by the Louisville District of the US Army Corps of Engineers (LRL) and began operation in June 1969. The primary purpose of the lake is flood control. The dam site is located at river mile 305.7 of the Green River, and at summer pool, the surface area of GRR is 8,210 acres. Note: The term "lake" is substituted for the technically correct "reservoir" throughout this document for consistency.

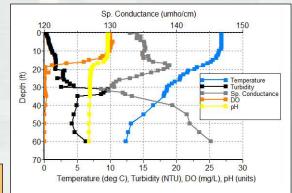


Figure 3. Field data taken at the dam site (2GRR20001; Figure 1) on 6/28/2017 at 08:00.



Figure 4. Aerial view of GRR

**Harmful Algal Blooms (HABs) in KY** are addressed by the KDOW as they are the lead agency for HAB response in the state. The KDOW has adopted HAB toxin sampling for posting public recreational advisories/cautions. The LRL WQ Program coordinates with, complies with, and supports the state agency's efforts to implement a statewide HAB response plan. LRL assists the KDOW with implementation by reporting visual HAB indicators and collecting HAB toxin samples at locations as specified by the KDOW.

Phytoplankton (Algae) and green plants are the base of the food chain in aquatic food webs and convert nutrients and CO<sub>2</sub> through photosynthesis into biomass for all aquatic life. The LRL WO Program sampled the phytoplankton community at GRR in June 2017. The distribution and identification of phytoplankton is measured throughout the water column at depths of 0,5,10, and 20 feet at multiple locations across the lake body.

Figure 6 illustrates the relative abundance and species richness for the entire phytoplankton community at GRR. The relative abundance percentage was calculated using the density of phytoplankton species from all sample sites, at all depths for each sampling event.

Planktolyngbya, a genera of cyanobacteria, was the dominant genera during the June sampling event.

**Zooplankton** are microscopic animals that live in the water column and are an important part of the food chain. The LRL WQ Program sampled the zooplankton community at the dam site (2GRR20001; Figure 1) using a Wisconsin net pull of 20 vertical feet. Figure 5 illustrates the relative abundance for the zooplankton community and species richness at GRR. Species richness is an indicator of community health, with greater community health as species richness increases. The top 3 dominant zooplankton were Asplanchna priodonta, sub-adult Cyclopoida, and Bosmina longirostris.

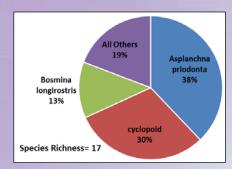


Figure 5. 2017 abundance of the zooplankton community at GRR.

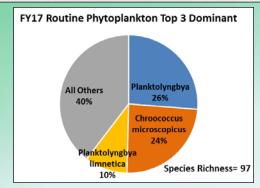


Figure 6. 2017 relative abundance of the entire phytoplankton community at GRR.

